



2793 Fenton Rd. Tel: (613) 822-1765
 Gloucester, Ontario Fax: (613) 822-1556
 K1T 3T9 Home Page: WWW.HOVEY.CA

Aug 25/98

FIELD AMENDMENT NOTICE
 #20 and #30 Moveable Point Frog Tieduct Systems

Distribution:

Union Pacific Railroad

A quantity of 22, #20 and 1, #30 MPF tieduct systems, Hovey part numbers 15273 and 15296 respectively, delivered to the UP railroad since November 97 have a design error which leaves a 1/4" gap between the center of the tieduct and the MPF baseplate.

To correct the problem, fill the gap with the supplied 1/4" steel plate spacer, and replace the 2" long bolts with the 2.5" long, as shown on the accompanying drawing "Field1".

This kit contains

Quantity	Hovey p/n	Description
1	-----	Spacer, 1/4" thick steel plate
4	9000-0083	Bolts, 7/8"UNC X 2.5" long, Grade L9
4	9002-1009	Lock washers, 7/8"
1	"Field1"	Field modification drawing / instruction

Modifications have been made to production MPF tieduct systems manufactured as of Aug 25/98.

Gregor Harris, P.Eng.,
 Manager of Engineering
 HOVEY INDUSTRIES LTD.