



Hovey
Industries Ltd.


2794 Fenton Road
Gloucester, On.,
K1T 3T7, Canada

Telephone: (613) 822-1765
Fax: (613) 822-1556

Field Amendment Notice 01-002

SUBJECT:	Incorrect field wiring of Hovey switch heaters.	FAN NO.	01-002
CONCERN:	Personnel safety hazard. Plans issued by UP headquarters to the field show incorrect wiring between the signal bungalow and the heaters. When wired according to the plans, disconnecting the heater panel breaker does not guarantee that the panel is de-energized.	DATE	Oct 2, 2001

Models Affected:	All Hovey Mark 6 bungalow enclosed, small enclosure and HELLFIRE 900's.
Problem	Plans issued by UP headquarters to the field show incorrect wiring between the signal bungalow and the heaters. A separate source of 120Vac is supplied from the signal bungalow to terminal A1 of the heater. Such wiring creates a personnel safety hazard. With the heater requested by dispatch the electrical panel is energized, with 120Vac, the heater will operate, with the local panel circuit breaker opened.
Corrective Action	Correct the wiring to provide a relay contact closure between terminals A1 and A2. Review field wiring against Hovey schematic 17676A (next page). Make corrections as necessary. Customers with questions can contact Hovey Industries Ltd. at 613-822-1765 for assistance.

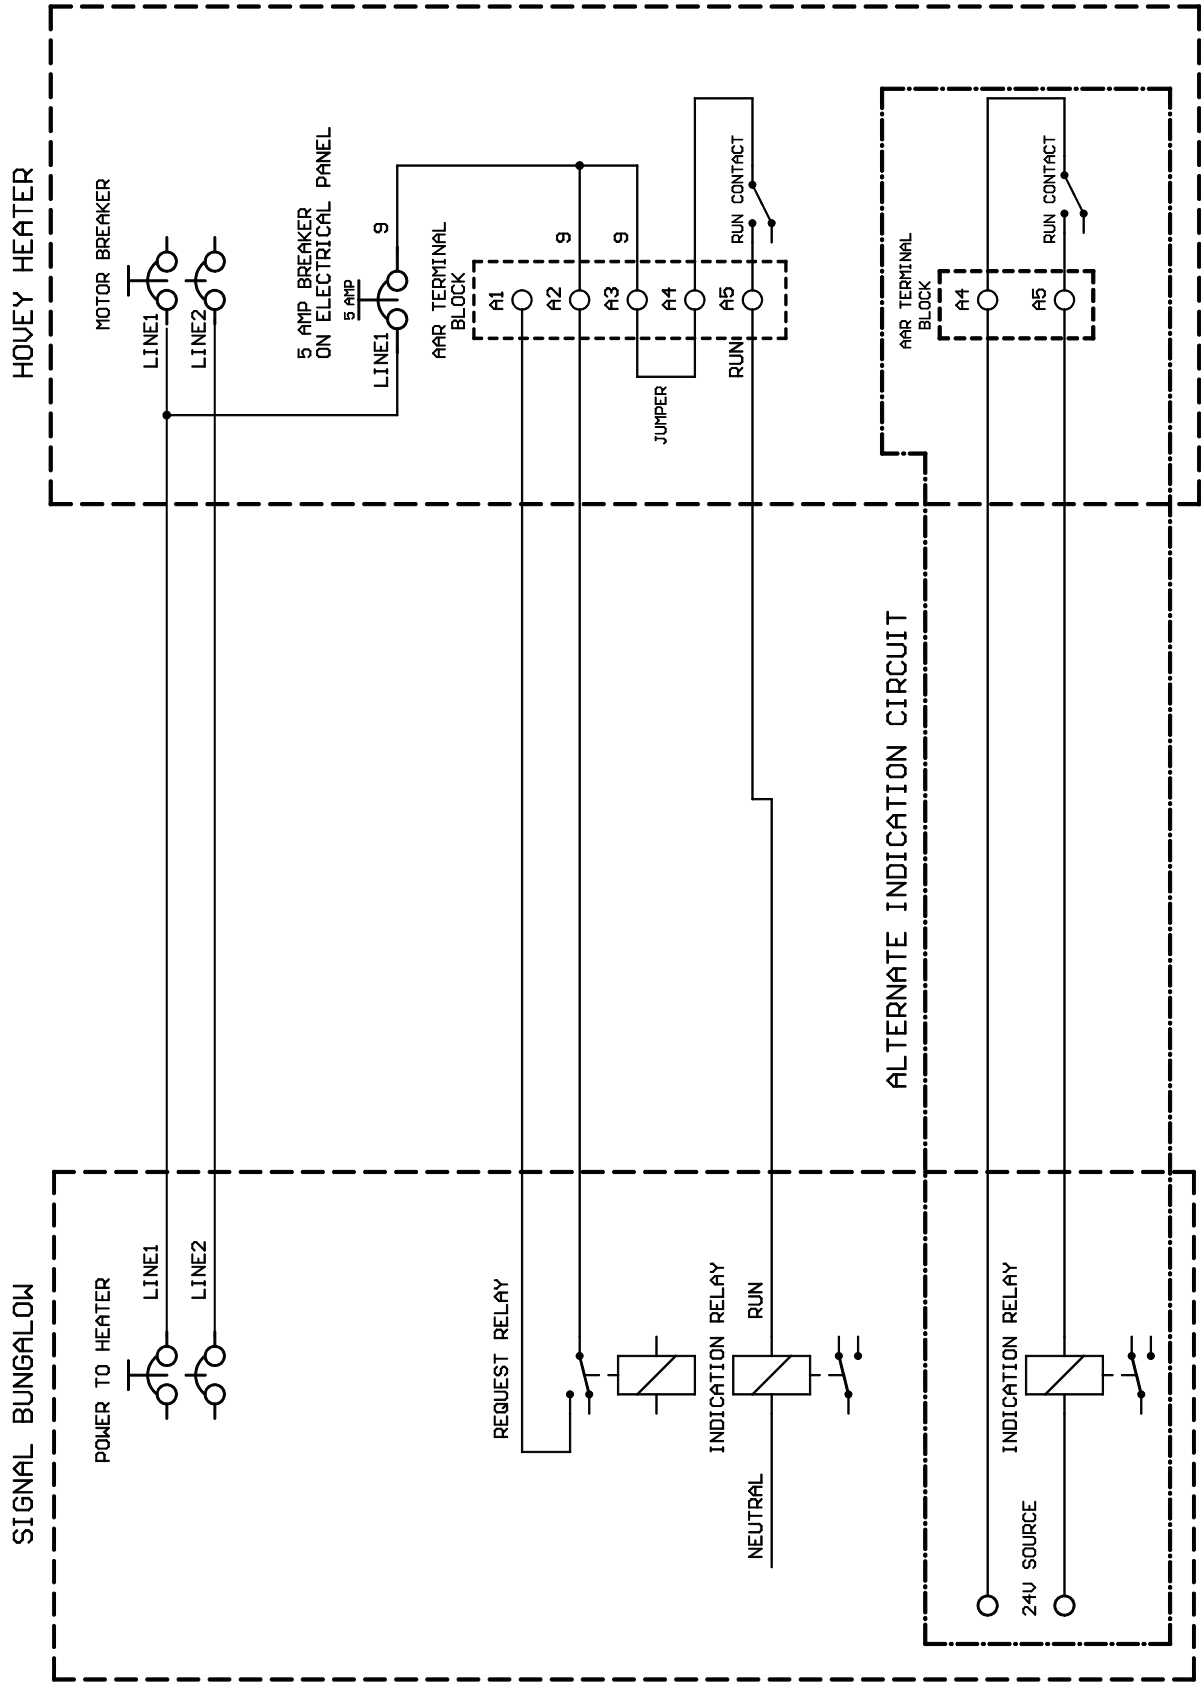

NOTES:

HOVEY INDUSTRIES LTD.				EAGLE	A4	A	DESCRIPTION		DATE	APP
DUN: GRU	DATE: 28. SEPT. 2001	CHKD	DATE:	LTR						